

WASH Site Profile - Camp 11

Ukhiya, Cox's Bazar, Bangladesh (March 2018) GPS Coordinates: 92.15574869 21.18276001



Summary

This profile provides an overview of water, sanitation and hygiene (WASH) infrastructure within Camp 11 in Ukhiya, Cox's Bazar. Primary data for this round was collected between 11 March - 2 April 2018. Findings should be considered indicative only.

Site Overview

| # of individuals: | 34167 |
|-------------------------------|-------|
| # of households: | 8327 |
| # of shelters: | 4928 |
| # of individuals per shelter: | 7 |

Key WASH Infrastructure


| # of latrines | 981 |
|-----------------------------------|-------|
| (% functional): | (77%) |
| % of safe latrines ² : | 81 |
| # of handpumps | 479 |
| (% functional): | (77%) |
| # of washrooms: | 417 |

Location Map





Access to Water

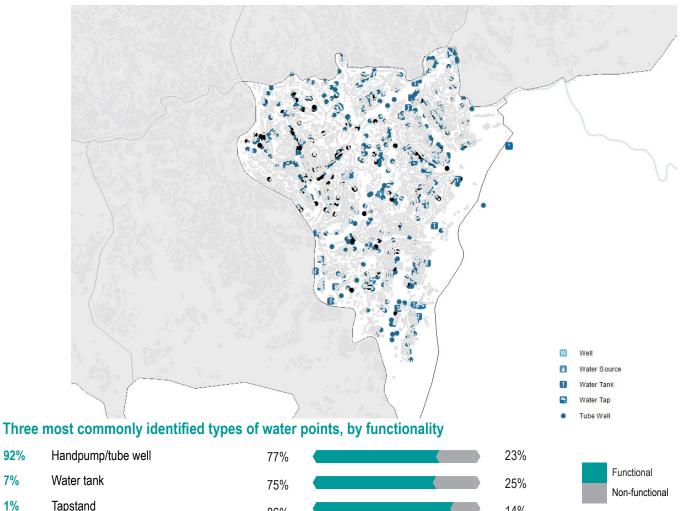

| 92% | Handpump/tube well | 77% | 23% | |
|-----|--------------------|-----|-----|----------------------------|
| 7% | Water tank | 75% | 25% | Functional Non-functional |
| 1% | Tapstand | 86% | 14% | Troil failure |

Key sectoral achievements

| ney sectoral acmevements | Target | Current Round | Achievement |
|--|-----------------------|----------------------|-------------|
| # of people per functional handpump | max. 250 ³ | 71 | |
| % of shelters with at least 1 functional handpump within 200m ⁴ | 100% | 100% | |

Targets based on WASH Sector Standards/Indicators for the Rohingya response, Sphere Minimum Standards/Indicators as well as Department of Public Health and Environment (DPHE) Minimum Standards/Indicators • Minimum standard/indicator reached, • 75%-99% minimum standard/indicator reached, •50-74% minimum standard/indicator reached, •Less than 50% of minimum standard/indicator reached

¹ REACH enumerators conducted a full sweep of all sites and camps (as per boundaries defined by ISCG) and used an Open Data Kit (ODK) form to log all key infrastructure observed during this sweep, with further details to be logged for WASH infrastructure. ² Safe refers to fully covered latrines (i.e. a latrine with four walls, a roof and a door) ³ This target is based on standards for the medium and long term (3 months +), for the immediate phase (0-3 months) it is 750 metres and for the medium phase (3-6 months) 500 metres.




WASH Site Profile - Camp 11





Sanitation

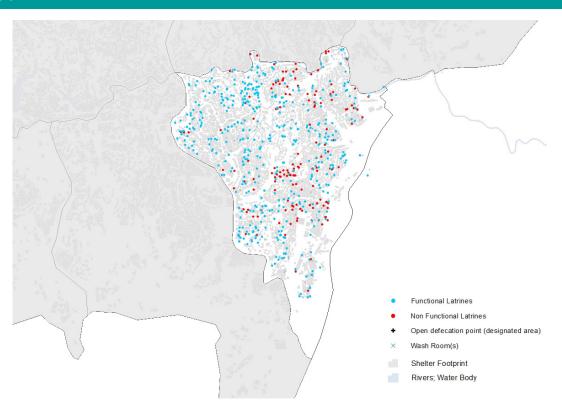

Latrine characteristics

% of functional/non-functional latrines



77% Functional (non-full) latrines23% Non-functional latrines

% of safe/unsafe latrines



% of latrines with/without lights



Key sectoral achievements

| | Target | Current Round | Achievement |
|---|----------------------|----------------------|-------------|
| # of people per functional (non-full) latrine | max. 20 ⁴ | 45 | |
| # of people per safe latrine | N/A | 43 | N/A |
| % of shelters with at least one functional latrine block within $50m$ | 100% | 96% | |
| % of functioning handpumps with no latrine within 10m | 100% | 48% | |

Targets based on WASH Sector Standards/Indicators for Rohingya response, Sphere Minimum Standards/Indicators as well as DPHE Minimum Standards/Indicators as

⁴This target is based on standards for the long term (6 months +), for the immediate phase (0-3 months) it is 100 and for the medium phase (3-6 months) 75.



