

WASH Site Profile - Camp 06

Ukhia, Cox's Bazar, Bangladesh (October 2018) GPS Coordinates: 92.1568, 21.2039

4,919

5



Summary

This profile provides an overview of water, sanitation and hygiene (WASH) infrastructure Camp 06 in Ukhia, Cox's Bazar. Primary data for this round was collected from 17 September to 22 October 2018. Findings should be considered indicative only. Full camp dataset is available on HDX.

Site Overview

of individuals: 24,564 # of households: 5,721

of shelters: # of individuals

Key WASH Infrastructure

# of latrines:	925
(% functional and safe ²):	(70%)
# of improved water sources: ³ (% functional):	505 (76%)
# of washrooms:	477

Location Map



Water Access

Three most commonly identified types of water points, by functionality:

per shelter:

91%	Handpump / tube well	75 %	25%	
5%	Water tank	89%	11%	Functional
3%	Tapstand	75 %	25%	Non-functional

Key sectoral standards:	Target	Current Round	Achievement
# of people per functional improved water source	max. 250	64	
% of shelters with at least 1 functional improved water source³ within 200m	100%	100%	
% of functional improved water sources with no latrine within 10m	100%	66%	

Sanitation

Latrine characteristics:

Functionality and safety



30%

70% Functional (non-full) and safe² Non-functional and / or unsafe

Functionality



Safety



91% Safe²

Unsafe

Lighting



1% 99% With lights Without lights

Key sectoral standards:	Target	Current Round	Achievement
# of people per functional (non-full) and safe latrine ²	max. 20	38	
# of people per functional (non-full) latrine	max. 20	34	
# of people per safe latrine ²	max. 20	32	
% of shelters with at least one functional and safe latrine² block within 50m	100%	100%	

Targets based on long term WASH Sector Standards / Indicators for the Rohingya response, Sphere Minimum Standards as well as Department of Public Health and Environment (DPHE) Minimum Standards. Minimum standard/indicator reached, 75%-99% minimum standard/indicator reached, 50-74% minimum standard/indicator reached, indicator reached, Less than 50% of minimum standard/indicator reached.



^{1.} REACH enumerators conducted a full sweep of all sites and camps (as per boundaries defined by ISCG) and used an Open Data Kit (ODK) form to log all key infrastructure observed during this sweep, with further


REACH endinerators conducted a four sweep or all sites and camps (as per boundaries de details to be logged for WASH infrastructure.
Safe refers to fully covered latrines (i.e. a latrine with four walls, a roof and a lockable door).
This includes handpumps / tube wells, tapstands and water tanks.

WASH Site Profile - Camp 06

Ukhia, Cox's Bazar, Bangladesh (October 2018) GPS Coordinates: 92.1568, 21.2039



Water Access

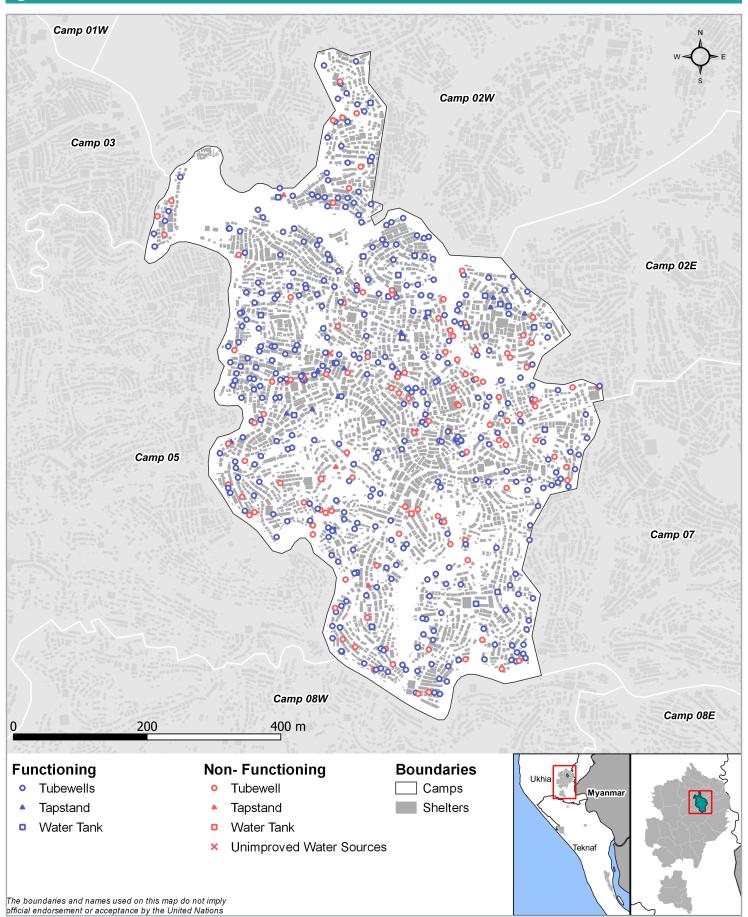



WASH Site Profile - Camp 06

Ukhia, Cox's Bazar, Bangladesh (October 2018) GPS Coordinates: 92.1568, 21.2039



3

Sanitation

